



ILS CAT II or III RWY 08L

ATIS 124.6	ARR 128.6/128.17 (Outer) 133.1 134.225 (Inner) 352.7	TWR 119.55(N) 226.5	GND 127.15(N) 275.8	DEP 126.125(N) 132.3(S) 363.8	ELEV 14 TDZE 08L 14
---------------	--	---------------------------	---------------------------	-------------------------------------	------------------------

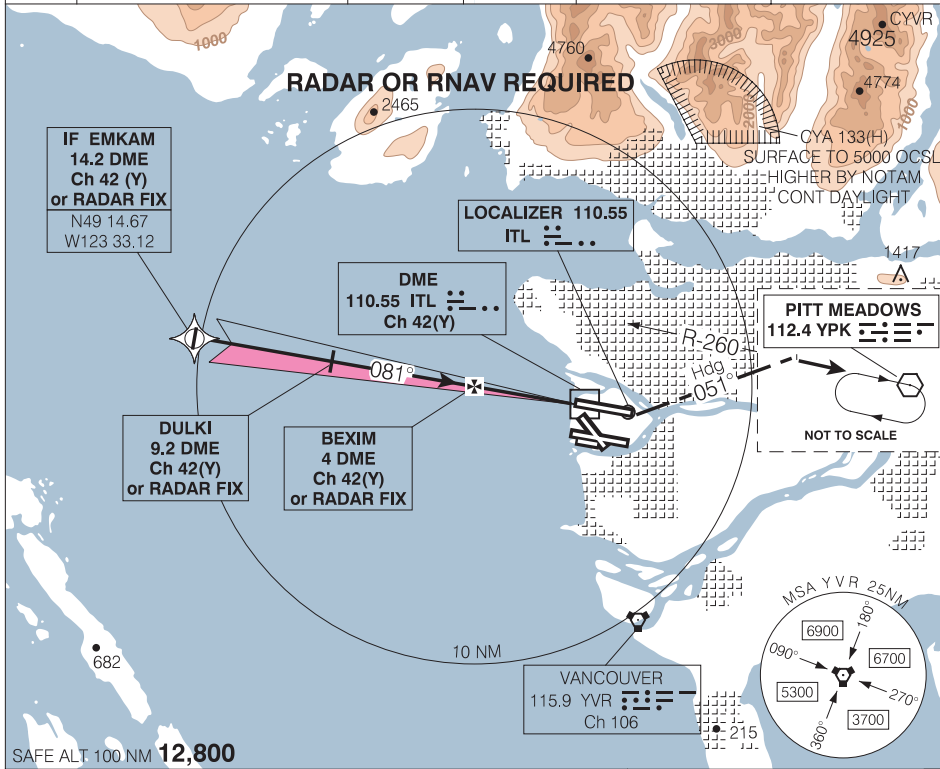

Source of Canadian Civil Aeronautical Data : © 2009 NAV CANADA. All rights reserved

EMKAM 14.2 DME Ch 42(Y) or RADAR FIX	DULKI 9.2 DME Ch 42(Y) or RADAR FIX	BEXIM 4 DME Ch 42(Y) or RADAR FIX	MISSED APPROACH Climb to 420 on HDG 081° then LEFT climbing turn HDG 051° to 2000 , intercept INBD R-260 from YPK*. Upon intercept climb to 4000 . Hold as published at *YPK*. Shuttle to 6000 BPOC.	PRIOR AUTH REQUIRED FROM TC
GP 3.0°				CAT II 114 (100) RVR 12
3000				CAT III A RVR 6
Procedure turn NOT AUTHORIZED.				CAT III B NOT AUTHORIZED
5.0 5.2 3.8				CAT III C NOT AUTHORIZED
TCH 51'				

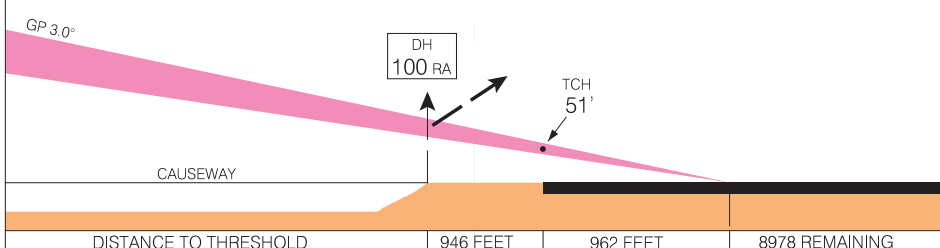

DISTANCE TO THRESHOLD	946 FEET	962 FEET	8978 REMAINING
-----------------------	----------	----------	----------------

ILS CAT II or III RWY 08L

491141N 1231102W

VAR 19°E

VANCOUVER BC
VANCOUVER INTL